
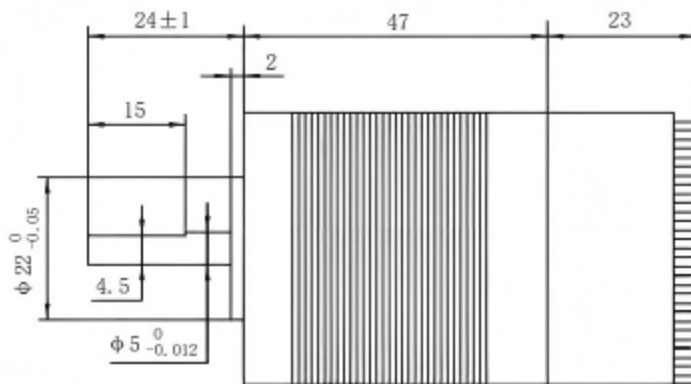


尺寸图 Dimensional drawing


绕线图 Wiring Diagram

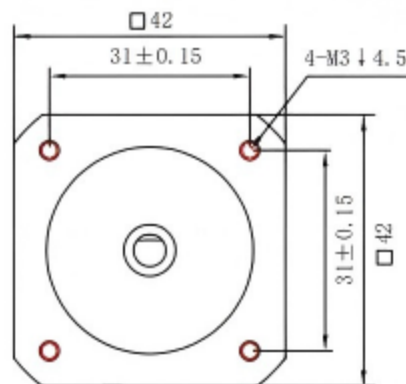

1.步距角 Step angle	1.8° ± 5%
2.相数 Number of phase	2
3.相电压 Phase voltage	2.0 VDC
4.相电流 Phase current	2.0 Amp
5.相电阻 Phase resistance	1.0 Ω ± 10% (At 20° C)
6.相电感 Phase inductance	1.9 mH ± 20%
7.静力矩 Static moment	0.52 N.m
8.绝缘等级 Insulation class	Class B
9.绝缘电阻 Insulation resistance	100MΩ min. (500V DC)
10.环境温度 Ambient temperature	-20° ~ +50°
11.环境湿度 Ambient hum	15% to 95%
12.电机重量 Motor weight	Approx 0.45 Kg
13.使用电压 Use voltage	VDC: 12-24V
14.推荐驱动器 Recommended drive	OK2D4020A

Subdivision Settings				
Pulse/rev	SW3	SW4	SW5	SW6
400	on	on	on	on
800	off	on	on	on
1600	on	off	on	on
3200	off	off	on	on
6400	on	on	off	on
12800	off	on	off	on
25600	on	off	off	on
51200	off	off	off	on
1000	on	on	on	off
2000	off	on	on	off
4000	on	off	on	off
5000	off	off	on	off
8000	on	on	off	off
10000	off	on	off	off
20000	on	off	off	off
40000	off	off	off	off

SW1	off	正转 Forward
SW1	on	反转 Reversal
SW2	off	2.1A
SW2	on	2.8A
PUL+	Pulse control signal	
PUL-	Pulse control signal	
DIR+	Direction control signal	
DIR-	Direction control signal	
ENA+	Enable control signal	
ENA-	Enable control signal	
AM+	Alarm signal output	
AM-	Alarm signal output	

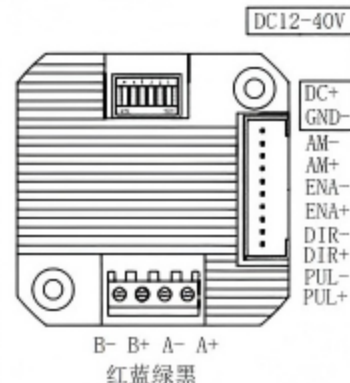

工艺 Technology		单位 Unit	mm
设计 Design			
审核 Chck			
批准 Approved	Betty Y	比列 Scale	1: 1

DRAWING

42FD47EC1-YT

Shenzhen Sunshine Sea Technology Co.,Ltd